

LETTERE DI SERVIZIO: # 01 2018

DATA: 18 Giugno 2018

PER: All CH7 KOMPRESS/CHARLIE

MODELLO/I: CH7 Kompress, CH7 Kompress Charlie

PRODOTTI / N.SERIE: 01 2018

OGGETTO ANOMALIA: CALENDAR LIMITATION

ISPEZIONE: CALEDAR

SOSTITUZIONE:

INTERVENTO CORRETTIVO:

With the aim of constantly improving aircraft production quality, safety and functioning, based on experienced developed in our Technical Support Centres and from Kit Assemblers, the need to inform Dealers, Authorized Maintenance Centers, Kit Assemblers and Owners, Pilots.

This amendment letter inform:

As for the version of the CH7chalie 2 and CH77Ranabot already present the live limitation for years, also for the kompress version you have to adopt the table in the Hand Book in the live / overhaul limited parts table and in the maintenance manual for section 3. LIVE-LIMITED COMPONENTS, obviously this amendment highlights a banal forgetfulness of writing, the new handbook for the Kompress version will be published shortly ,on official Web Site www.ch-7helicopter.com /Section Service.

COMPONENT DESCRIPTION

PART NUMBER

S/N

INSTALL.

TBO hours or 12 year
ENGINE EPA/ROTAX
UNAIRWORTHY
2005
1500
FRAME
UNAIRWORTHY
2005
1500
MAIN GEAR BOX
UNAIRWORTHY
180
2005

DATE/HRS

MAIN ROTOR HUB
UNAIRWORTHY
2005
1500
MAIN ROTOR HUB
UNAIRWORTHY
2005
2005 1500
1500
1500 MAIN ROTOR BLADE
1500 MAIN ROTOR BLADE UNAIRWORTHY

MAIN ROTOR BLADE
UNAIRWORTHY
400
2005
1500
TAIL GEAR BOX
UNAIRWORTHY
185
2005
1500
TAIL ROTOR HUB
UNAIRWORTHY
2005
1500

TAIL ROTOR HUB
UNAIRWORTHY
2005
1500
TAIL ROTOR BLADE
UNAIRWORTHY
2005
1500
TAIL ROTOR BLADE
UNAIRWORTHY
2005
1500
CLUTCH MOTOR

2005
1500
GOVERNOR MOTOR
UNAIRWORTHY
2005
1500
WARNING BOX CARD
UNAIRWORTHY
2005
1500
TUBE COOLER LINE
UNAIRWORTHY

UNAIRWORTHY

2005
5 year or 1500
TUBE OIL LINE
UNAIRWORTHY
2005
5 year or 1500
FUEL LINE SET
UNAIRWORTHY
2005
5 year or 1500
MAIN TRANSMISSION BELT
UNAIRWORTHY

5 year or 500

in practice if the component has been installed for 12 years or more on the aircraft it is un-airworthu. the aircraft must be subjected to 12-year or 1500-hour maintenance inspection. to simplify the visual inspection on the CH7 Kompress aircraft:

if the Blades have a S/N number equal to or less than the number S/N 400 are unairworthy if the Main Transmission box has the S/Number equal to or lower than S/N180. it is unairworthy if the Tail Transmission box has the S/Number equal to or lower than S/N 185 it is unairworthy

Dealers in particular are required to alert their Pilots and Clients to the importance and Mandatory of registering on the official Helisport site as indicated in Section 7.0 of the pilot manual, in order to avoid the legal and insurance risks mentioned below. Any body may fly a Helisport aircraft without having first

registered on the official Helisport website and read all documentation contained on it.

Dealers, Authorised Maintenance Centres, Kit Assemblers, Owners, Pilots are required to apply and/or enforce all service bulletins on aircraft affected by this amendment and transcribe this intervention into the maintenance log as required by Section 7.1 of the pilot manual.Remember that the pilot manual is the only document that has legal value and all sections must be strictly respected; non-application of a single bulletin renders an aircraft unairworthy and therefore out of compliance with

Helisport Company requirements or with Legal and Insurance requirements;